


City of Minneapolis Truth in Sale of Housing  
**CERTIFICATE OF APPROVAL**

Matthew L Prater  
5424 45TH AVE S  
Minneapolis, MN 55417

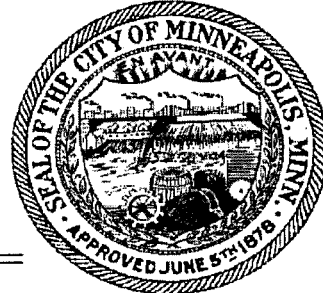

---

**Address Evaluated:** 5424 45TH AVE S

**Issued To:** Matthew L Prater

**Issued Date:** September 12, 2013

**Report Number:** 20135134

**Report Date:** September 12, 2013

**Certificate Expires:** September 12, 2015

This is to certify that the above mentioned address has been inspected pursuant to Minneapolis City Ordinance 248 and that any repairs required per Minneapolis City Ordinance 248 as amended December 23, 2005 have been repaired or replaced as required.

The Truth-in-Sale-of-Housing Disclosure Report, subsequent inspections and issuance of this certificate are not guarantees or warranties to any individual buyer, seller or renter regarding the condition of the dwelling; nor is the evaluation report, inspection(s) or certificate intended for the special benefit of any individual.

The City of Minneapolis does not assume any responsibility or liability in connection with the inspection addressed herein or in connection with the issuance of this Certificate of Approval

---

*Issued by the Department of Regulatory Services, Truth in Sales of Housing section.*

# Truth in Sale of Housing Disclosure Report

NOTICE - Read Entire Report Carefully. This is not a Buyer's Inspection!

Address: 5424 45TH AVE S Minneapolis, MN



Current Owner Name: Matthew L Prater

Contact: Matthew L Prater

Business/Relationship:

Owner Address: 5424 45TH AVE S

Minneapolis, MN 55417

I declare to the best of my knowledge the following information:

This property has had environmental testing, removal, or remediation of environmental contamination by the United States Environmental Protection Agency, Minnesota Pollution Control Agency, other governmental agency, or under the direction of such agency: Yes / No

If yes, the seller shall provide the testing, removal, or remediation results to the buyer.

Water Damage to Property: flood damage sewer backup water seepage

Please Describe:

Age of Roof: 14 Condition of Roof: Poor Fair Good Excellent Currently Leaking: Yes/No No Patched: Yes / No

\* Signature of Owner: (Report Not Valid Without Signature) [Signature]

\*Date: 7/13/13

\*\*\*\*\* SEE ATTACHED PAGES FOR IMPORTANT CONSUMER INFORMATION \*\*\*\*\*

Observed Number of Units: 1

City Reference as: 1

Building Type: Single Family Home

Present Occupancy: Conforming

Zoning: AP - Ap Airport Overlay District

Housing Orders: No

Condemnation Status: NA

Reason: NA

1. This report offers a limited overview of the building components and fixtures and is not technically extensive. Prospective buyers may want to seek additional opinions from various experts in the inspections field prior to purchase. This report is not a warranty or guarantee, expressed or implied, by the City of Minneapolis or by the evaluator or of any building component or fixture. Further, the buyer may want to seek additional information regarding any open permits. For 1<sup>st</sup> time condominium units, this report includes only those items located within the residential units. The Professional Opinion covers those items in the common areas of the building.
2. The buyer must repair all items marked Repair/Replace, unless the seller agrees to do the repairs. The seller is not required to complete the RR's if the property does not sell. All required Repair/Replace items are enforceable by Minneapolis Ordinance Chapter 248 and/or 250. All other items will not be used by the Inspections Division as a basis for enforcing Minneapolis ordinances.
3. The ordinance requires that no person shall exhibit or show a dwelling for sale without first having obtained an official Evaluation Report and places the responsibility on the seller or agent to make sure that this report (and in the case of 1<sup>st</sup> time condo conversions, the Professional Opinion,) is publicly displayed on the premises at all times when the house is shown to prospective buyers. Also, the seller or agent must give a copy of this report (and Professional Opinion for 1<sup>st</sup> time condo conversions) to the buyer prior to the signing of a Purchase Agreement, or as otherwise required in Minneapolis Ordinance Chapter 248 and/or 250.
4. This report covers only those items listed on the form. The evaluator is not required to ignite the heating plant, use a ladder to observe the condition of the roofing, evaluate inaccessible or concealed areas or disassemble items. This report does not address formaldehyde, lead paint, any airborne gasses (including radon), asbestos, wood stoves, fireplaces or air conditioners. Gas inserts in fireplaces WILL be evaluated.
5. This report is not an FHA, VA or Section 8 inspection. This report is not a code compliance inspection. It is not an appraisal. This report may be based upon different standards than the lender, FHA or VA.
6. The seller is required to provide the disclosure information in the box above. If this is not filled out, buyers are advised to request the seller to do so.
7. This report is valid for two years from the date of issue and only for the owner named on the report. It is required for all single-family homes, duplexes, townhouses or 1<sup>st</sup> time condominium conversions offered for sale.
8. **Any questions** regarding this report should be directed to the evaluator whose name and phone number appear below.  
**Any complaints** regarding this report should be directed to Truth in Housing at (612) 673-5840, Minneapolis Inspections Division, 250 South 4<sup>th</sup> Street #300, Minneapolis, MN 55415.

I hereby certify that this report is made in compliance with the Minneapolis Code of Ordinances, Chapter 248, and that I utilized care and diligence reasonable and ordinary for one meeting the Certification Standards. The report covers only those problems listed and reasonably visible at the time of my evaluation and does not warrant future useful life of any house component or fixture. I have included all required information pages with this report.

Evaluator Name: Alan Copia

Phone: 612-824-2000


Evaluation Date: 9/12/2013

Signature: Alan Copia

Evaluation #: 20135134

# Truth in Sale of Housing Disclosure Report

Address: 5424 45TH AVE S Minneapolis, MN



## EVALUATION CODES:

**M** :=Meets Minimum Requirements    **C** :=Comments    **NA** :=Not Applicable/Does Not Apply    **B** :=Below Minimum Requirements    **SC** :=Suggested Correction  
**RRE** :=Repair/Replace, Evaluator Verification Required    **RRP** :=Repair/Replace, Permit/City Inspector Required    **LIC** :=Safety Check, Licensed Contractor Required

Each item may have more than one code. Items marked "RRE" or "RRP" indicate that the item must be repaired or replaced within 90 days of closing. Items marked "LIC" require a licensed contractor to evaluate the safety of the item and may or may not require a repair. Buyer must sign acknowledgment of responsibility agreement unless a Certificate of Approval (COA) has been issued to seller. If the house doesn't sell, the seller does not have to do the repairs. See attached handout on the "MOST COMMON REPAIRS".

## Basement

---

1. Basement Stairs/Railings
  - B, Stairway headroom is less than 6' 8".
  - B, Below Minimum Requirements: - B, Handrail ends do not return to the wall
2. Basement Floors
  - M, Meets Minimum Requirements
3. Foundation Walls
  - M, Meets Minimum Requirements
4. Evidence of Dampness or Staining
  - M, Meets Minimum Requirements
5. First Floor, Floor System
  - M, Meets Minimum Requirements
6. Columns & Beams
  - M, Meets Minimum Requirements
7. Basement Sleeping Rooms
  - C, There are no basement bedrooms.
8. Basement Plumbing Fixtures
  - M, Meets Minimum Requirements
9. Sump Pumps
  - C, No sump pump present.
10. Smoke Detectors / CO Detectors
  - M, Meets Minimum Requirements
11. Basement Electrical Outlets/Fixtures
  - M, Meets Minimum Requirements

## Electric

---


**Amps:** 100

**Volts:** 115/230

12. Electrical service installation
  - C, Other Comment: - C, Fuses
13. Separate 20-amp Kitchen Circuit indexed at Service Panel
  - M, Meets Minimum Requirements
14. Separate 20-amp Laundry Circuit indexed at Service Panel
  - C, Separate 20-amp laundry circuit is not indexed at service panel

# Truth in Sale of Housing Disclosure Report

Address: 5424 45TH AVE S Minneapolis, MN



## EVALUATION CODES:

<b>M</b> :=Meets Minimum Requirements	<b>C</b> :=Comments	<b>NA</b> :=Not Applicable/Does Not Apply	<b>B</b> :=Below Minimum Requirements	<b>SC</b> :=Suggested Correction
<b>RRE</b> :=Repair/Replace, Evaluator Verification Required	<b>RRP</b> :=Repair/Replace, Permit/City Inspector Required	<b>LIC</b> :=Safety Check, Licensed Contractor Required		

## Plumbing

---

- 15. Floor Drains  
M, Meets Minimum Requirements
- 16. Drain, Waste & Vent Piping  
M, Meets Minimum Requirements
- 17. Water Supply Piping  
M, Meets Minimum Requirements
- 18. Gas Piping  
M, Meets Minimum Requirements
- 19. Copper Water Line Visible on the Street Side of Water Meter  
M, Meets Minimum Requirements

## Water heater

---

- 20. Water Heater & Installation  
M, Meets Minimum Requirements
- 21. Water Heater Venting  
M, Meets Minimum Requirements

## Heating

---

**HeatingFuel:** Gas

**HeatingType:** Forced Air

- 22. Heating Plant Viewed in Operation  
M, Meets Minimum Requirements
- 23. Heating Plant & Installation  
SC, Suggested Correction: - SC, makeshift filter installation. Filter should be installed in the proper location.
- 24. Heating Plant Combustion Venting  
M, Meets Minimum Requirements
- 25. Incinerator / Abandoned Oil Tanks / Misc Gas Fixtures  
NA, Not Applicable/Does Not Apply

# Truth in Sale of Housing Disclosure Report

Address: 5424 45TH AVE S Minneapolis, MN



## EVALUATION CODES:

<b>M</b> :=Meets Minimum Requirements	<b>C</b> :=Comments	<b>NA</b> :=Not Applicable/Does Not Apply	<b>B</b> :=Below Minimum Requirements	<b>SC</b> :=Suggested Correction
<b>RRE</b> :=Repair/Replace, Evaluator Verification Required		<b>RRP</b> :=Repair/Replace, Permit/City Inspector Required		<b>LIC</b> :=Safety Check, Licensed Contractor Required

## Laundry

---

- 26. Gas Piping  
M, Meets Minimum Requirements
- 27. Dryer Venting  
M, Meets Minimum Requirements
- 28. Plumbing Fixtures  
M, Meets Minimum Requirements


## Kitchen

---

- 29. Walls and Ceiling Components  
M, Meets Minimum Requirements
- 30. Evidence of Dampness or Staining  
M, Meets Minimum Requirements
- 31. Floor Condition  
M, Meets Minimum Requirements
- 32. Window Size & Openable Area  
M, Meets Minimum Requirements
- 33. Window & Door Condition/Mechanical Venting  
M, Meets Minimum Requirements
- 34. Electrical Outlets/Fixtures  
M, Meets Minimum Requirements
- 35. Plumbing Fixtures  
M, Meets Minimum Requirements
- 36. Water Flow  
M, Meets Minimum Requirements
- 37. Gas Piping  
M, Meets Minimum Requirements

# Truth in Sale of Housing Disclosure Report

Address: 5424 45TH AVE S Minneapolis, MN



## EVALUATION CODES:

<b>M</b> :=Meets Minimum Requirements	<b>C</b> :=Comments	<b>NA</b> :=Not Applicable/Does Not Apply	<b>B</b> :=Below Minimum Requirements	<b>SC</b> :=Suggested Correction
<b>RRE</b> :=Repair/Replace, Evaluator Verification Required		<b>RRP</b> :=Repair/Replace, Permit/City Inspector Required		<b>LIC</b> :=Safety Check, Licensed Contractor Required

## Dining Room/Living Room

---

- 38. Walls and Ceiling Components
  - M, Meets Minimum Requirements
- 39. Evidence of Dampness or Staining
  - M, Meets Minimum Requirements
- 40. Floor Area & Ceiling Height
  - M, Meets Minimum Requirements
- 41. Floor Condition
  - M, Meets Minimum Requirements
- 42. Window Size & Openable Area
  - M, Meets Minimum Requirements
- 43. Window & Door Condition
  - M, Meets Minimum Requirements
- 44. Electrical Outlets/Fixtures
  - M, Meets Minimum Requirements


## Bathroom (1st floor)

---

- 45. Walls & Ceiling Components
  - M, Meets Minimum Requirements
- 46. Evidence of Dampness or Staining
  - M, Meets Minimum Requirements
- 47. Floor Condition
  - M, Meets Minimum Requirements
- 48. Window Size & Openable Area/Mechanical Vent
  - M, Meets Minimum Requirements
- 49. Window & Door Condition
  - M, Meets Minimum Requirements
- 50. Electrical Outlets & Fixtures
  - M, Meets Minimum Requirements
- 51. Plumbing Fixtures
  - C, Other Comment: - C, cracked top at toilet tank.
  - SC, Suggested Correction: - SC, slight leak at waste pipe (lav sink).
- 52. Water Flow
  - M, Meets Minimum Requirements

# Truth in Sale of Housing Disclosure Report

Address: 5424 45TH AVE S Minneapolis, MN



## EVALUATION CODES:

M :=Meets Minimum Requirements	C :=Comments	NA :=Not Applicable/Does Not Apply	B :=Below Minimum Requirements	SC :=Suggested Correction
RRE :=Repair/Replace, Evaluator Verification Required		RRP :=Repair/Replace, Permit/City Inspector Required		LIC :=Safety Check, Licensed Contractor Required

## Hallways/Stairwells

---

- 53. Walls and Ceiling Components
  - M, Meets Minimum Requirements
- 54. Evidence of Dampness or Staining
  - M, Meets Minimum Requirements
- 55. Floor Condition
  - M, Meets Minimum Requirements
- 56. Window & Door Condition
  - M, Meets Minimum Requirements
- 57. Electrical Outlets/Fixtures
  - M, Meets Minimum Requirements
- 58. Stairs and Railings
  - B, Below Minimum Requirements: - B, Low guardrail, less than 36". B, Handrail ends do not return to wall
- 59. Smoke Detectors /CO Detectors
  - M, Meets Minimum Requirements


## Bedroom (1st fl North)

---

- 60. Walls and Ceiling Components
  - M, Meets Minimum Requirements
- 61. Evidence of Dampness or Staining
  - M, Meets Minimum Requirements
- 62. Floor Area & Ceiling Height
  - M, Meets Minimum Requirements
- 63. Floor Condition
  - M, Meets Minimum Requirements
- 64. Window Size & Openable Area
  - M, Meets Minimum Requirements
- 65. Window & Door Condition
  - M, Meets Minimum Requirements
- 66. Electrical Outlets/Fixtures
  - M, Meets Minimum Requirements

# Truth in Sale of Housing Disclosure Report

Address: 5424 45TH AVE S Minneapolis, MN



## EVALUATION CODES:

M :=Meets Minimum Requirements	C :=Comments	NA :=Not Applicable/Does Not Apply	B :=Below Minimum Requirements	SC :=Suggested Correction
RRE :=Repair/Replace, Evaluator Verification Required	RRP :=Repair/Replace, Permit/City Inspector Required	LIC :=Safety Check, Licensed Contractor Required		

## Bedroom (1st fl South)

---

- 60. Walls and Ceiling Components
  - M, Meets Minimum Requirements
- 61. Evidence of Dampness or Staining
  - M, Meets Minimum Requirements
- 62. Floor Area & Ceiling Height
  - M, Meets Minimum Requirements
- 63. Floor Condition
  - M, Meets Minimum Requirements
- 64. Window Size & Openable Area
  - M, Meets Minimum Requirements
- 65. Window & Door Condition
  - B, Fogged glass indicates broken thermal seal on door/window(s).
- 66. Electrical Outlets/Fixtures
  - M, Meets Minimum Requirements

## Bedroom (2nd fl West)


---

- 60. Walls and Ceiling Components
  - M, Meets Minimum Requirements
- 61. Evidence of Dampness or Staining
  - M, Meets Minimum Requirements
- 62. Floor Area & Ceiling Height
  - B, Below Minimum Requirements: - B, Less than required ceiling height for a bedroom.
- 63. Floor Condition
  - M, Meets Minimum Requirements
- 64. Window Size & Openable Area
  - M, Meets Minimum Requirements
- 65. Window & Door Condition
  - B, Fogged glass indicates broken thermal seal on door/window(s).
- 66. Electrical Outlets/Fixtures
  - M, Meets Minimum Requirements



# Truth in Sale of Housing Disclosure Report

Address: 5424 45TH AVE S Minneapolis, MN



## EVALUATION CODES:

<b>M</b> :=Meets Minimum Requirements	<b>C</b> :=Comments	<b>NA</b> :=Not Applicable/Does Not Apply	<b>B</b> :=Below Minimum Requirements	<b>SC</b> :=Suggested Correction
<b>RRE</b> :=Repair/Replace, Evaluator Verification Required		<b>RRP</b> :=Repair/Replace, Permit/City Inspector Required		<b>LIC</b> :=Safety Check, Licensed Contractor Required

## Bedroom (2nd fl South)

---

### 60. Walls and Ceiling Components

M, Meets Minimum Requirements

### 61. Evidence of Dampness or Staining

M, Meets Minimum Requirements

### 62. Floor Area & Ceiling Height

B, Below Minimum Requirements: - B, Less than required ceiling height for a bedroom.

### 63. Floor Condition

M, Meets Minimum Requirements

### 64. Window Size & Openable Area

M, Meets Minimum Requirements

### 65. Window & Door Condition

M, Meets Minimum Requirements

### 66. Electrical Outlets/Fixtures

M, Meets Minimum Requirements

## Porch/Sunroom/Other

---

Not Applicable

## Attic Space

---

**InsulationType:** cellulose

**InsulationDepth:** 6-9

### 72. Roof Boards & Rafters / Ventilation

C, Other Comment: - C, No visible attic access, viewed at front knee wall area only.

### 73. Evidence of Dampness or Staining

C, There is evidence of past dampness or staining in the attic on roof boards and rafters.

### 74. Electrical Outlets & Fixtures

C, Wiring is not visible.

### 75. Mechanical Venting

C, Other Comment: - C, not visible

# Truth in Sale of Housing Disclosure Report

Address: 5424 45TH AVE S Minneapolis, MN



## EVALUATION CODES:

<b>M</b> :=Meets Minimum Requirements	<b>C</b> :=Comments	<b>NA</b> :=Not Applicable/Does Not Apply	<b>B</b> :=Below Minimum Requirements	<b>SC</b> :=Suggested Correction
<b>RRE</b> :=Repair/Replace, Evaluator Verification Required		<b>RRP</b> :=Repair/Replace, Permit/City Inspector Required		<b>LIC</b> :=Safety Check, Licensed Contractor Required

## Exterior

---

### 76. Foundation

M, Meets Minimum Requirements

### 77. Basement Windows

M, Meets Minimum Requirements

### 78. Drainage (Grade) / Rainleaders

M, Meets Minimum Requirements

### 79. Exterior Walls

M, Meets Minimum Requirements

### 80. Doors (frames/storms/screens/deadbolt locks)

M, Meets Minimum Requirements

### 81. Windows (frames/storms/screens)

M, Meets Minimum Requirements

### 82. Stoops

M, Meets Minimum Requirements

### 83. Cornice & Trim

M, Meets Minimum Requirements

### 84. Roof Covering & Flashing

C, Other Comment: - C, Portions of roof are not visible due to angle of view.

### 85. Chimney

M, Meets Minimum Requirements

### 86. Electrical Outlets/Fixtures

SC, Low service drop. Lacks 10' clearance to grade or 12' clearance over driveway.

### 87. Exterior Plumbing-Backflow Prevention

M, Meets Minimum Requirements

### 88. Two-Family Dwelling Egress

NA, Not Applicable/Does Not Apply

## Open/Unheated Porch

---

Not Applicable

# Truth in Sale of Housing Disclosure Report

Address: 5424 45TH AVE S Minneapolis, MN



**City of Minneapolis**  
Truth in Sale of Housing

## EVALUATION CODES:

<b>M</b> :=Meets Minimum Requirements	<b>C</b> :=Comments	<b>NA</b> :=Not Applicable/Does Not Apply	<b>B</b> :=Below Minimum Requirements	<b>SC</b> :=Suggested Correction
<b>RRE</b> :=Repair/Replace, Evaluator Verification Required		<b>RRP</b> :=Repair/Replace, Permit/City Inspector Required		<b>LIC</b> :=Safety Check, Licensed Contractor Required

## Garage

---

- 94. Roof Structure & Covering  
M, Meets Minimum Requirements
- 95. Wall Structure & Covering  
C, Other Comment: - C, stored items, limited views.
- 96. Garage Doors  
M, Meets Minimum Requirements
- 97. Automatic Garage Door Opener  
M, Meets Minimum Requirements
- 98. Electrical Outlets/Fixtures  
M, Meets Minimum Requirements

## Miscellaneous

---

- 99. Clutter/Sanitation/Vermin  
NA, Not Applicable/Does Not Apply
- 100. Other  
NA, Not Applicable/Does Not Apply

# Truth in Sale of Housing Disclosure Report

Address: 5424 45TH AVE S Minneapolis, MN



**Truth in Housing Repair Notification**  
City of Minneapolis-Inspections Division  
Truth in Sale of Housing, 250 South 4th Street, Room 300  
Minneapolis, MN 55415

**Issued To:**

9/12/2013

Matthew L Prater  
5424 45TH AVE S  
Minneapolis, MN 55417

Owner does not have to complete repairs if the house is not sold.

Pursuant to Minneapolis Code of Ordinances, Sections 248.20 and 248.225, the owner may make the repairs. If the owner makes the repairs, a Certificate of Approval (needed for closing) will be issued after the repairs have been inspected and approved. The owner does not have to complete the repairs if the house does not sell. If the owner does not make the repairs, the buyer must sign an acknowledgement of responsibility form (provided by the City) and return it to the City. The buyer has 90 days from closing to complete the repairs. Your prompt cooperation in attending to the repair items is appreciated however, failure to comply by these deadlines may result in legal action.

**REQUIRED REPAIRS**

NONE

**SAFETY CHECKS**

The systems listed below must be checked by a licensed contractor. The contractor must be licensed by the City of Minneapolis and/or the State of Minnesota in that specific trade to check the work. Return safety check forms to the address above or fax to (612) 673-2437. If "Evaluator Return" is indicated below, the evaluator may return to view the system that was not in operation at the time of the initial evaluation. The evaluator may find additional work is needed on the system.

If the system was repaired or replaced, only a licensed contractor (not the evaluator) can do the safety check. Permits may be needed.

NONE

**PERMIT REQUIRED REPAIR**

The permit must be pulled before scheduling. Call the inspector listed on the permit to set an appointment. You need to have the permit number to set the appointment. There will be a charge for the permit, which covers the inspection.

NONE

**Reinspection Process**

When all the items are completed they must be inspected and approved.

***For items that need a permit:***

If your notification indicates PERMIT NEEDED, the permit(s) must be pulled and work completed BEFORE the re-inspection takes place. If you are a homeowner occupant of a single family house, you may obtain a permit, if you are not, you must hire a licensed contractor. Bring this notification with you when you apply for permits.

***For items that do not need a permit:***

Call the evaluator who did the initial TISH report to re-inspect all the non-permit items. The evaluator's name and phone number are on the bottom of page 1 of the report. There will be a charge for this inspection.

**Appeal**

This repair notice may be appealed. Section 248.150 of the Minneapolis Code of Ordinances provides that an appeal must be filed in writing within thirty (30) days of the date of this notice accompanied with a \$100 filing fee. If you wish to appeal this order, call (612) 673-5840 for an application.

# Truth in Sale of Housing Disclosure Report

Address: 5424 45TH AVE S Minneapolis, MN



## Assistance

If you need financial assistance to complete these repairs, you may call the Greater Metropolitan Housing Corporation (GMHC) at 612-378-7985.

# New Seller/Listing Information Sheet



Listing				
Listing Address*	Suite/Unit #	City*	State*	Zip*
5424 45th Avenue S		Minneapolis	MN	55417

List Price (\$)*	MLS ID	Listing Date	Expiration Date	PID:
				1902823110036

Seller				
First Name*	Last Name*	Middle Init	Email* (for Homebase & BAS)	Phone*
Matthew	Prater		prater@mac.com	651-246-6457
First Name	Last Name	Middle Init	Email (for Homebase & BAS)	Phone
Nicole	Prater		nicolee19@outlook.com	612-568-2532

Listing Agent			
Agent Name*	Agent ID*	Percent*	
Laurie Allen	502004719	42.5	
Agent Name	Agent ID	Percent	

Showing Instructions				
<input type="checkbox"/> Must Reach	<input checked="" type="checkbox"/> Knock First	<input checked="" type="checkbox"/> Lights ON or <u>OFF</u>	<input checked="" type="checkbox"/> Remove Shoes	
<input type="checkbox"/> Dog/Cat	<input checked="" type="checkbox"/> Leave Card	<input checked="" type="checkbox"/> Vacant	<input checked="" type="checkbox"/> Leave message, then show	
BookAShowing = Auto Approve in BAS? <input checked="" type="checkbox"/> YES <input checked="" type="checkbox"/> NO Allow overlapping Appts in BAS? <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO Keep Private? <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO				
Allow Login? <input checked="" type="checkbox"/> YES <input checked="" type="checkbox"/> NO Show Fdbk? <input checked="" type="checkbox"/> YES <input checked="" type="checkbox"/> NO Email alerts? <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO Text alerts? <input checked="" type="checkbox"/> YES <input checked="" type="checkbox"/> NO (if yes, provider) _____				
Special Instructions: _____				
Lockbox Type:	Electronic	Location:	Front Door	Combination: _____ Shackle: _____
Seller's Address (if different from listing address): 5424 45th Avenue S, Minneapolis, MN 55417				

Prioritize numbers per seller's instructions (please indicate cell, work or home):

<input checked="" type="checkbox"/> Seller 1#:	651-246-6457	Tenant Name:	_____
<input checked="" type="checkbox"/> Seller 1#:	612-568-2532	Tenant #:	_____
<input type="checkbox"/> Seller 2#:	_____		
<input type="checkbox"/> Seller 2#:	_____		

Sign Information			
Do you need a sign installed? <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO # of Signs: <u>1</u> Sprinkler System: <input checked="" type="checkbox"/> YES <input checked="" type="checkbox"/> NO Brochure Box? <input checked="" type="checkbox"/> YES <input checked="" type="checkbox"/> NO			
SIGN LOCATION MUST HAVE FLAG OR TEMP SIGN. UN-FLAGGED LOCATES ARE SUBJECT TO LARGE FINES! Invisible fence? <input checked="" type="checkbox"/> YES <input checked="" type="checkbox"/> NO			
Nearest Intersecting Street:	E. 54th Street	King Map:	121 Coord: B3
Directions to Home:	Hiawatha/55 to west on E. 54th St, to south on 45th Ave to home		
Special Instructions: _____			

Miscellaneous	
Seller Purchasing AHS Home Protection Plan? YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> Seller Closing with Burnet Title? YES <input checked="" type="checkbox"/> NO <input type="checkbox"/>	
Thank you letter: (circle one) <u>MAIL LETTER</u> EMAIL LETTER	
Broker Tour? <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO If YES, Date: <u>9.17.13</u> Time: <u>11-1</u>	
If YES (circle one): Lunch <input type="checkbox"/> Snack <input type="checkbox"/> Dessert <input type="checkbox"/> None <input type="checkbox"/>	
Remarks:	_____

(12/11)

