

City of Minneapolis Truth in Sale of Housing
CERTIFICATE OF APPROVAL

Cynthia A Dean
3836 38TH AVE S
Minneapolis, MN 55406



Address Evaluated: 3836 38TH AVE S

Issued To: Cynthia A Dean

Issued Date: March 11, 2016

Report Number: 20160953

Report Date: March 11, 2016

Certificate Expires: March 11, 2018

This is to certify that the above mentioned address has been inspected pursuant to Minneapolis City Ordinance 248 and that any repairs required per Minneapolis City Ordinance 248 as amended December 23, 2005 have been repaired or replaced as required.


The Truth-in-Sale-of-Housing Disclosure Report, subsequent inspections and issuance of this certificate are not guarantees or warranties to any individual buyer, seller or renter regarding the condition of the dwelling; nor is the evaluation report, inspection(s) or certificate intended for the special benefit of any individual.

The City of Minneapolis does not assume any responsibility or liability in connection with the inspection addressed herein or in connection with the issuance of this Certificate of Approval

Issued by the Department of Regulatory Services, Truth in Sales of Housing section.

Truth in Sale of Housing Disclosure Report

NOTICE - Read Entire Report Carefully. This is not a Buyer's Inspection!

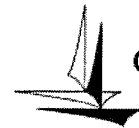Address: 3836 38TH AVE S Minneapolis, MN**City of Minneapolis**

Truth in Sale of Housing

Current Owner Name: Cynthia A Dean**Contact:** Cynthia A Dean**Business/Relationship:****Owner Address:** 3836 38TH AVE S
Minneapolis, MN 55406**I declare to the best of my knowledge the following information:**

This property has had environmental testing, removal, or remediation of environmental contamination by the United States Environmental Protection Agency, Minnesota Pollution Control Agency, other governmental agency, or under the direction of such agency: Yes / No

If yes, the seller shall provide the testing, removal, or remediation results to the buyer.

Water Damage to Property: flood damage sewer backup water seepage

Please Describe:

Age of Roof: _____ **Condition of Roof:** Poor Fair Good Excellent **Currently Leaking:** Yes / No **Patched:** Yes / No**Signature of Owner:** (Report Not Valid Without Signature)**Date:** 03/14/2016

***** SEE ATTACHED PAGES FOR IMPORTANT CONSUMER INFORMATION *****

Observed Number of Units: 1**City Reference as:** 1**Building Type:** Single Family Home**Present Occupancy:** Conforming**Zoning:** R1A - Single Family District('99)**Housing Orders:** No**Condemnation Status:** NA**Reason:** NA


1. This report offers a limited overview of the building components and fixtures and is not technically extensive. Prospective buyers may want to seek additional opinions from various experts in the inspections field prior to purchase. This report is not a warranty or guarantee, expressed or implied, by the City of Minneapolis or by the evaluator or of any building component or fixture. Further, the buyer may want to seek additional information regarding any open permits. For 1st time condominium units, this report includes only those items located within the residential units. The Professional Opinion covers those items in the common areas of the building.
2. The buyer must repair all items marked Repair/Replace, unless the seller agrees to do the repairs. The seller is not required to complete the RR's if the property does not sell. All required Repair/Replace items are enforceable by Minneapolis Ordinance Chapter 248 and/or 250. All other items will not be used by the Inspections Division as a basis for enforcing Minneapolis ordinances.
3. The ordinance requires that no person shall exhibit or show a dwelling for sale without first having obtained an official Evaluation Report and places the responsibility on the seller or agent to make sure that this report (and in the case of 1st time condo conversions, the Professional Opinion,) is publicly displayed on the premises at all times when the house is shown to prospective buyers. Also, the seller or agent must give a copy of this report (and Professional Opinion for 1st time condo conversions) to the buyer prior to the signing of a Purchase Agreement, or as otherwise required in Minneapolis Ordinance Chapter 248 and/or 250.
4. This report covers only those items listed on the form. The evaluator is not required to ignite the heating plant, use a ladder to observe the condition of the roofing, evaluate inaccessible or concealed areas or disassemble items. This report does not address formaldehyde, lead paint, any airborne gasses (including radon), asbestos, wood stoves, fireplaces or air conditioners. Gas inserts in fireplaces WILL be evaluated.
5. This report is not an FHA, VA or Section 8 inspection. This report is not a code compliance inspection. It is not an appraisal. This report may be based upon different standards than the lender, FHA or VA.
6. The seller is required to provide the disclosure information in the box above. If this is not filled out, buyers are advised to request the seller to do so.
7. This report is valid for two years from the date of issue and only for the owner named on the report. It is required for all single-family homes, duplexes, townhouses or 1st time condominium conversions offered for sale.
8. **Any questions** regarding this report should be directed to the evaluator whose name and phone number appear below.
Any complaints regarding this report should be directed to Truth in Housing at (612) 673-5840, Minneapolis Inspections Division, 250 South 4th Street #300, Minneapolis, MN 55415.

I hereby certify that this report is made in compliance with the Minneapolis Code of Ordinances, Chapter 248, and that I utilized care and diligence reasonable and ordinary for one meeting the Certification Standards. The report covers only those problems listed and reasonably visible at the time of my evaluation and does not warrant future useful life of any house component or fixture. I have included all required information pages with this report.

Evaluator Name: Alan Copia**Phone:** 612-824-2000**Evaluation Date:** 3/11/2016**Signature:** Alan Copia**Evaluation #:** 20160953

Truth in Sale of Housing Disclosure Report

Address: 3836 38TH AVE S Minneapolis, MN



City of Minneapolis
Truth in Sale of Housing

EVALUATION CODES:

M :=Meets Minimum Requirements C :=Comments NA :=Not Applicable/Does Not Apply B:=Below Minimum Requirements SC:=Suggested Correction
RRE :=Repair/Replace, Evaluator Verification Required RRP :=Repair/Replace, Permit/City Inspector Required LIC:=Safety Check, Licensed Contractor Required

Each item may have more than one code. Items marked "RRE" or "RRP" indicate that the item must be repaired or replaced within 90 days of closing. Items marked "LIC" require a licensed contractor to evaluate the safety of the item and may or may not require a repair. Buyer must sign acknowledgment of responsibility agreement unless a Certificate of Approval (COA) has been issued to seller. If the house doesn't sell, the seller does not have to do the repairs. See attached handout on the "MOST COMMON REPAIRS".

Basement

1. Basement Stairs/Railings

- B, Riser height is greater than 8".
- B, Tread depth is less than 9".
- B, Stairway headroom is less than 6' 8".
- B, Missing guardrail on open side of stairs.
- B, Below Minimum Requirements: - B, Handrail ends do not return to the wall

2. Basement Floors

- C, Other Comment: - C, Views of the floor are limited by stored items.

3. Foundation Walls

- C, Other Comment: - C, Limited views of foundation walls due to stored items.

4. Evidence of Dampness or Staining

- C, Evidence of past dampness and/or staining.

5. First Floor, Floor System

- M, Meets Minimum Requirements

6. Columns & Beams

- M, Meets Minimum Requirements

7. Basement Sleeping Rooms

- C, There are no basement bedrooms.

8. Basement Plumbing Fixtures

- M, Meets Minimum Requirements

9. Sump Pumps

- C, No sump pump present.

10. Smoke Detectors / CO Detectors

- M, Meets Minimum Requirements

11. Basement Electrical Outlets/Fixtures

- SC, Pendant type lights or outlets in use. Installation of new fixtures requires a state electric permit.
- B, Below Minimum Requirements: - B, inoperative ceiling fixture.

Electric

Amps: 100

Volts: 115/230

12. Electrical service installation

- B, Service panel not (fully) indexed.

13. Separate 20-amp Kitchen Circuit indexed at Service Panel

- M, Meets Minimum Requirements

14. Separate 20-amp Laundry Circuit indexed at Service Panel

- M, Meets Minimum Requirements

Truth in Sale of Housing Disclosure Report

Address: 3836 38TH AVE S Minneapolis, MN



City of Minneapolis
Truth in Sale of Housing

EVALUATION CODES:

M := Meets Minimum Requirements

C := Comments

NA := Not Applicable/Does Not Apply

B := Below Minimum Requirements

SC := Suggested Correction

RRE := Repair/Replace, Evaluator Verification
Required

RRP := Repair/Replace, Permit/City Inspector Required

LIC := Safety Check, Licensed Contractor Required

Plumbing

15. Floor Drains

M, Meets Minimum Requirements

16. Drain, Waste & Vent Piping

M, Meets Minimum Requirements

17. Water Supply Piping

M, Meets Minimum Requirements

18. Gas Piping

M, Meets Minimum Requirements

19. Copper Water Line Visible on the Street Side of Water Meter

M, Meets Minimum Requirements

Water heater

20. Water Heater & Installation

M, Meets Minimum Requirements

21. Water Heater Venting

C, Other Comment: - C, electric, no venting required.

Heating

HeatingFuel: Gas

HeatingType: Forced Air

22. Heating Plant Viewed in Operation

M, Meets Minimum Requirements

23. Heating Plant & Installation

M, Meets Minimum Requirements

24. Heating Plant Combustion Venting

M, Meets Minimum Requirements

25. Incinerator / Abandoned Oil Tanks / Misc Gas Fixtures

NA, Not Applicable/Does Not Apply

Laundry

26. Gas Piping

B, Below Minimum Requirements: - B, Lacks Sediment trap.

27. Dryer Venting

M, Meets Minimum Requirements

28. Plumbing Fixtures

M, Meets Minimum Requirements

Evaluator Name: Alan Copia

Evaluation Date: 3/11/2016

Page 3 of 11

Evaluation #: 20160953

Truth in Sale of Housing Disclosure Report

Address: 3836 38TH AVE S Minneapolis, MN



City of Minneapolis
Truth in Sale of Housing

EVALUATION CODES:

M := Meets Minimum Requirements

C := Comments

NA := Not Applicable/Does Not Apply

B := Below Minimum Requirements

SC := Suggested Correction

RRE := Repair/Replace, Evaluator Verification
Required

RRP := Repair/Replace, Permit/City Inspector Required

LIC := Safety Check, Licensed Contractor Required

Kitchen

- 29. Walls and Ceiling Components
 - M, Meets Minimum Requirements
- 30. Evidence of Dampness or Staining
 - M, Meets Minimum Requirements
- 31. Floor Condition
 - M, Meets Minimum Requirements
- 32. Window Size & Openable Area
 - M, Meets Minimum Requirements
- 33. Window & Door Condition/Mechanical Venting
 - M, Meets Minimum Requirements
- 34. Electrical Outlets/Fixtures
 - M, Meets Minimum Requirements
- 35. Plumbing Fixtures
 - M, Meets Minimum Requirements
- 36. Water Flow
 - M, Meets Minimum Requirements
- 37. Gas Piping
 - C, Other Comment: - C, Gas piping not visible (stove is electric).

Dining Room/Living Room

- 38. Walls and Ceiling Components
 - M, Meets Minimum Requirements
- 39. Evidence of Dampness or Staining
 - M, Meets Minimum Requirements
- 40. Floor Area & Ceiling Height
 - M, Meets Minimum Requirements
- 41. Floor Condition
 - M, Meets Minimum Requirements
- 42. Window Size & Openable Area
 - M, Meets Minimum Requirements
- 43. Window & Door Condition
 - M, Meets Minimum Requirements
- 44. Electrical Outlets/Fixtures
 - M, Meets Minimum Requirements

Truth in Sale of Housing Disclosure Report

Address: 3836 38TH AVE S Minneapolis, MN



City of Minneapolis
Truth in Sale of Housing

EVALUATION CODES:

M := Meets Minimum Requirements

C := Comments

NA := Not Applicable/Does Not Apply

B := Below Minimum Requirements

SC := Suggested Correction

RRE := Repair/Replace, Evaluator Verification
Required

RRP := Repair/Replace, Permit/City Inspector Required

LIC := Safety Check, Licensed Contractor Required

Bathroom (1st floor)

45. Walls & Ceiling Components

M, Meets Minimum Requirements

46. Evidence of Dampness or Staining

M, Meets Minimum Requirements

47. Floor Condition

M, Meets Minimum Requirements

48. Window Size & Openable Area/Mechanical Vent

M, Meets Minimum Requirements

49. Window & Door Condition

C, Other Comment: - C, the window inside the tub surround is not marked as tempered glass.

50. Electrical Outlets & Fixtures

M, Meets Minimum Requirements

51. Plumbing Fixtures

M, Meets Minimum Requirements

52. Water Flow

M, Meets Minimum Requirements

Hallways/Stairwells

53. Walls and Ceiling Components

M, Meets Minimum Requirements

54. Evidence of Dampness or Staining

M, Meets Minimum Requirements

55. Floor Condition

M, Meets Minimum Requirements

56. Window & Door Condition

M, Meets Minimum Requirements

57. Electrical Outlets/Fixtures

M, Meets Minimum Requirements

58. Stairs and Railings

B, Improper rise & run.

B, Narrow stairs.

B, Below Minimum Requirements: - B, Handrail ends do not return to wall B, Low guardrail, less than 36".

59. Smoke Detectors /CO Detectors

C, Other Comment:

Truth in Sale of Housing Disclosure Report

Address: 3836 38TH AVE S Minneapolis, MN



City of Minneapolis
Truth in Sale of Housing

EVALUATION CODES:

M :=Meets Minimum Requirements	C :=Comments	NA :=Not Applicable/Does Not Apply	B :=Below Minimum Requirements	SC :=Suggested Correction
RRE :=Repair/Replace, Evaluator Verification Required	RRP :=Repair/Replace, Permit/City Inspector Required	LIC :=Safety Check, Licensed Contractor Required		

Bedroom (1st floor)


- 60. Walls and Ceiling Components
 - M, Meets Minimum Requirements
- 61. Evidence of Dampness or Staining
 - M, Meets Minimum Requirements
- 62. Floor Area & Ceiling Height
 - M, Meets Minimum Requirements
- 63. Floor Condition
 - M, Meets Minimum Requirements
- 64. Window Size & Openable Area
 - M, Meets Minimum Requirements
- 65. Window & Door Condition
 - M, Meets Minimum Requirements
- 66. Electrical Outlets/Fixtures
 - M, Meets Minimum Requirements

Bedroom (2nd fl south)

- 60. Walls and Ceiling Components
 - M, Meets Minimum Requirements
- 61. Evidence of Dampness or Staining
 - M, Meets Minimum Requirements
- 62. Floor Area & Ceiling Height
 - B, Below Minimum Requirements: - B, Less than required ceiling height for a bedroom.
- 63. Floor Condition
 - M, Meets Minimum Requirements
- 64. Window Size & Openable Area
 - B, Windows do not meet egress requirements. Does not meet standards for a bedroom. New window installation requires a building permit.
- 65. Window & Door Condition
 - M, Meets Minimum Requirements
- 66. Electrical Outlets/Fixtures
 - M, Meets Minimum Requirements

Truth in Sale of Housing Disclosure Report

Address: 3836 38TH AVE S Minneapolis, MN



City of Minneapolis
Truth in Sale of Housing

EVALUATION CODES:

M :=Meets Minimum Requirements	C :=Comments	NA :=Not Applicable/Does Not Apply	B :=Below Minimum Requirements	SC :=Suggested Correction
RRE :=Repair/Replace, Evaluator Verification Required	RRP :=Repair/Replace, Permit/City Inspector Required	LIC :=Safety Check, Licensed Contractor Required		

Bedroom (2nd fl east)

- 60. Walls and Ceiling Components
 - M, Meets Minimum Requirements
- 61. Evidence of Dampness or Staining
 - M, Meets Minimum Requirements
- 62. Floor Area & Ceiling Height
 - B, Below Minimum Requirements: - B, Less than required ceiling height for a bedroom.
- 63. Floor Condition
 - M, Meets Minimum Requirements
- 64. Window Size & Openable Area
 - M, Meets Minimum Requirements
- 65. Window & Door Condition
 - M, Meets Minimum Requirements
- 66. Electrical Outlets/Fixtures
 - M, Meets Minimum Requirements

Porch/Sunroom/Other (2nd fl north)

- 67. Walls and Ceiling Components
 - M, Meets Minimum Requirements
- 68. Evidence of Dampness or Staining
 - M, Meets Minimum Requirements
- 69. Floor Condition, Area & Ceiling Height
 - M, Meets Minimum Requirements
- 70. Window & Door Condition
 - M, Meets Minimum Requirements
- 71. Electrical Outlets/Fixtures
 - M, Meets Minimum Requirements

Attic Space

InsulationType:Fiberglass roll

InsulationDepth:3-6

- 72. Roof Boards & Rafters / Ventilation
 - C, Other Comment: - C, no upper attic, viewed at knee wall areas only.
- 73. Evidence of Dampness or Staining
 - C, There is evidence of past dampness or staining in the attic on roof boards and rafters.
- 74. Electrical Outlets & Fixtures
 - C, Wiring is not visible.
- 75. Mechanical Venting
 - C, Other Comment: - C, not visible

Truth in Sale of Housing Disclosure Report

Address: 3836 38TH AVE S Minneapolis, MN



City of Minneapolis
Truth in Sale of Housing

EVALUATION CODES:

M :=Meets Minimum Requirements

C :=Comments

NA :=Not Applicable/Does Not Apply

B:=Below Minimum Requirements

SC:=Suggested Correction

RRE :=Repair/Replace, Evaluator Verification
Required

RRP :=Repair/Replace, Permit/City Inspector Required

LIC :=Safety Check, Licensed Contractor Required

Exterior

76. Foundation

M, Meets Minimum Requirements

77. Basement Windows

M, Meets Minimum Requirements

78. Drainage (Grade) / Rainleaders

M, Meets Minimum Requirements

79. Exterior Walls

M, Meets Minimum Requirements

80. Doors (frames/storms/screens/deadbolt locks)

M, Meets Minimum Requirements

81. Windows (frames/storms/screens)

M, Meets Minimum Requirements

82. Stoops

M, Meets Minimum Requirements

83. Cornice & Trim

M, Meets Minimum Requirements

84. Roof Covering & Flashing

M, Meets Minimum Requirements

85. Chimney

M, Meets Minimum Requirements

86. Electrical Outlets/Fixtures

M, Meets Minimum Requirements

87. Exterior Plumbing-Backflow Prevention

M, Meets Minimum Requirements

88. Two-Family Dwelling Egress

NA, Not Applicable/Does Not Apply

Open/Unheated Porch (front porch)

89. Floors

C, Other Comment: - C, floor slopes.

90. Walls

M, Meets Minimum Requirements

91. Roof/Ceiling

M, Meets Minimum Requirements

92. Doors/Screens/Windows


M, Meets Minimum Requirements

93. Electrical Outlets/Fixtures

M, Meets Minimum Requirements

Truth in Sale of Housing Disclosure Report

Address: 3836 38TH AVE S Minneapolis, MN



City of Minneapolis
Truth in Sale of Housing

EVALUATION CODES:

M :=Meets Minimum Requirements

C :=Comments

NA :=Not Applicable/Does Not Apply

B :=Below Minimum Requirements

SC :=Suggested Correction

RRE :=Repair/Replace, Evaluator Verification
Required

RRP :=Repair/Replace, Permit/City Inspector Required

LIC :=Safety Check, Licensed Contractor Required

Garage

94. Roof Structure & Covering

M, Meets Minimum Requirements

95. Wall Structure & Covering

M, Meets Minimum Requirements

96. Garage Doors

M, Meets Minimum Requirements

97. Automatic Garage Door Opener

M, Meets Minimum Requirements

98. Electrical Outlets/Fixtures

M, Meets Minimum Requirements

Miscellaneous

99. Clutter/Sanitation/Vermin

NA, Not Applicable/Does Not Apply

100. Other

NA, Not Applicable/Does Not Apply

Truth in Sale of Housing Disclosure Report

Address: 3836 38TH AVE S Minneapolis, MN



Truth in Housing Repair Notification

City of Minneapolis-Inspections Division

Truth in Sale of Housing, 250 South 4th Street, Room 300

Minneapolis, MN 55415

Issued To:

3/11/2016

Cynthia A Dean
3836 38TH AVE S
Minneapolis, MN 55406

Owner does not have to complete repairs if the house is not sold.

Pursuant to Minneapolis Code of Ordinances, Sections 248.20 and 248.225, the owner may make the repairs. If the owner makes the repairs, a Certificate of Approval (needed for closing) will be issued after the repairs have been inspected and approved. The owner does not have to complete the repairs if the house does not sell. If the owner does not make the repairs, the buyer must sign an acknowledgement of responsibility form (provided by the City) and return it to the City. The buyer has 90 days from closing to complete the repairs. Your prompt cooperation in attending to the repair items is appreciated however, failure to comply by these deadlines may result in legal action.

REQUIRED REPAIRS

NONE

SAFETY CHECKS

The systems listed below must be checked by a licensed contractor. The contractor must be licensed by the City of Minneapolis and/or the State of Minnesota in that specific trade to check the work. Return safety check forms to the address above or fax to (612) 673-2437. If "Evaluator Return" is indicated below, the evaluator may return to view the system that was not in operation at the time of the initial evaluation. The evaluator may find additional work is needed on the system.

If the system was repaired or replaced, only a licensed contractor (not the evaluator) can do the safety check. Permits may be needed.

NONE

PERMIT REQUIRED REPAIR

The permit must be pulled before scheduling. Call the inspector listed on the permit to set an appointment. You need to have the permit number to set the appointment. There will be a charge for the permit, which covers the inspection.

NONE

Reinspection Process

When all the items are completed they must be inspected and approved.

For items that need a permit:

If your notification indicates PERMIT NEEDED, the permit(s) must be pulled and work completed BEFORE the re-inspection takes place. If you are a homeowner occupant of a single family house, you may obtain a permit, if you are not, you must hire a licensed contractor. Bring this notification with you when you apply for permits.

For items that do not need a permit:

Call the evaluator who did the initial TISH report to re-inspect all the non-permit items. The evaluator's name and phone number are on the bottom of page 1 of the report. There will be a charge for this inspection.

Appeal

This repair notice may be appealed. Section 248.150 of the Minneapolis Code of Ordinances provides that an appeal must be filed in writing within thirty (30) days of the date of this notice accompanied with a \$100 filing fee. If you wish to appeal this order, call (612) 673-5840 for an application.

Truth in Sale of Housing Disclosure Report

Address: 3836 38TH AVE S Minneapolis, MN



Assistance

If you need financial assistance to complete these repairs, you may call the Greater Metropolitan Housing Corporation (GMHC) at 612-378-7985.